


Board fragment showing addition of smoothing capacitor.  
PCB 98002 ISSUE 3.

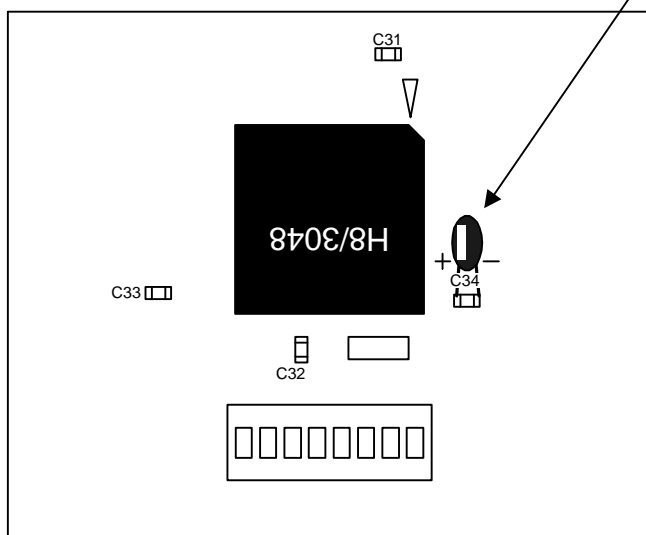

Board fragment showing addition of smoothing capacitor.  
PCB 98002 ISSUE 1 & 2.

#### Reason for modification:

System noise can cause pan/tilt hunting during goto preset operation as preset reference voltage can fluctuate.

The additional capacitor suppresses this noise.

Value: between 1 & 10uF 16V TANTALUM BEAD CAPACITOR

A suitable part is supplied by RS Components with part number: 180-1595